

Return of the W. & A. R. R.
and W. & A. R. R. - 11-18 -

LOG BOOK

From 1st Feb 82 to
to 5th May 82

B.R. 205/1

ALL STAFF

~~PLEASE~~ ~~KNOW~~ ~~YOUR~~ ~~OWN~~ ~~BUS~~ ~~PL.~~

~~FOR~~ ~~WORK~~ ~~AND~~ ~~CALL~~ ~~PL.~~



NEWTON HEATH D.D. 3606.

LONGSIGHT. 3558.

ALLERTON. 2936.

CREWE - 053, 2793

LOCO'S A EXAM. 25. - 2.50 ^(1.20) WITH BOILER. 3.50 hrs.

" " " 40. - 3.15 + ⁽⁷⁰⁾ " 4.25 hrs.

" " " 47. - 2.80 + ⁽⁸⁵⁾ " 4.00 hrs.

MOLYHUNTS G.P.O. No 0407 - 2304

" 055 - 3100.

DYNAMO BELT COUPLING STOCK IS CODE CE 9 TIME .50

2 CAR DIESEL UNIT SERVICE CHECK IS 0.56 MC 0.70 P/c P/c P/c

3 " " " " " " 0.98 P/c P/c P/c

MONDAY. 1ST. FEB 82.
B. A. ROBERTS. M. PRICE.

CARS FUELED ETC: 51178
56335.

LOCOS FUELED. 40097 25323. 25069. 40034

47515. CALLED TO STATION E.T.H NOT WORKING. JUMPER CABLE NOT CONNECTED PROPERLY. REFITTED & TESTED.

51920 CALLED TO WHANDUENO. HEATER & PANELS LOOSE. SECURED & TESTED.

51203 BOTH ENDS RACING. NO.1 THROTTLE E.P. VALVE STUCK. RELEASED & CLEANED & TESTED.

40034 LUB OIL STARTER VALVE JOINT LEAKING BADLY. REMOVED & NEW JOINTS MADE & FITTED.

25069 FLAT BATTERS. DUD BATT CELLS NOCO ISOLATED TO BE HAWLED TO CREW FOR REPAIRS.

51178 NO.2 ENG RAD FAN BELTS MISSING NEW BELTS FITTED & NEW STUDS FITTED TO ADJUSTING PLATES

D. HILL. M. PRICE. R. COX 20.00 HRS.

CARS FUELED ETC:-
50784/56452. 51919/56161

LOCO'S. FUELED ETC:-
40002. 25220. BOLLOR FITTED.

47515. CALL TO STATION. E.T.H. KNOCKING OFF. SUSPECT. JUMPER CABLES. NO.2. AND. DEFECTIVE. CREW MAINT INFORMED LOCO WORKED. TO MANCHESTER.

51919. CALL TO STATION. NO.2 ENGINE FAN BELTS MISSING AND. F/DR FROM A TAD. CAR TO WORK TO WHANDUENO THEM BACK ON SHED FOR REPAIRS.

25220. NOS & NO.6 EXHAUST PIPE JOINTS BLOWING NEW JOINTS FITTED & TESTED.

50784. NO.1 ENG EXHAUST BELTS MISSING NEW BELTS FITTED & TESTED

56452. FLAT BATTERS CHARGED ETC:-

51919. NO.2 ENG FAN MOTOR HOLDING STUDS BROKEN. NEW STUDS MADE & FITTED. NEW FAN BELTS FITTED ENG & F/DR DEISOLATED & TESTED.

TUE 2 - 2 - 82

CHAFOULKES P. Con. D. TREGGS.

P/Car	MILES
51178	50900
51920	34340
51200	9900
50949	U/R
50784	—
51919	2870

R.T. 68204 }
 " 66308 } Full.

FUEL IN TANKS No 1 400 No 2 400 TOTAL 800 Empty.

CARS FUEL OIL WATER etc.

51178 - 51920 - 51200 - 50949 - 50784 - 51919
 56335 56504 56359 56232 56452 56151

Locos: 40002 - 40069 - 40003 - 25323 - 47462

40002 A EXAM COMPLETED AT 139190 MILES LUB OIL
 OIL BRACK BLOCKS OR. ONLY 1/2 TANK OF FUEL. 400 GALS.

STEAM STEEL

642 S2 S2 S2 OR S2 S2 890
 80515 - 25375 - 24887 - 25582 - 15935 - 24109 - 25857 - 81031

56504 ATTENTION TO DRAGONAIR HEATER MADE TO WORK

B.A. ROBERTS. M. PRICE.

CARS FUELLED ETC: 50929 50939
56361 52046.

LOCOS FUELLED ETC: 40002 40003. 25200. 40033.

4010 CALLED TO PENSWARN BRIDGE. LOCO LOSS OF POWER
BLOWING CONTROL FUSES. LOCO ISOLATED & HAULED
BACK TO DEPOT. FOR REPAIRS. UNABLE TO TRACE
FAULT LOCO TO BE HAULED TO CREWE.

25200 SANDERS MADE TO WORK.

56361 FRAT PARTS. PUT ON CHARGE. NO. 9 FUSE RENEWED

RAIL TANKER NO 66308 UNLOADED.

D. HILL. M. PRICE. P. COX 20.00.
CARS PULLED ETC:-

51175/56333. 50546/59218/50593.

LOCO'S PULLED ETC:-
25323 47515. 40022.

- 47462. CALL TO STATION. DR REPORTED WARTH FAULT FLAG
RESET & TESTED FOR POWER NO FAULT FOUND.
- 40069. CALL TO YARD DROP LIGHT WINDOW 2ND MAN'S
SIDE WILL NOT SHUT. REPAIRED.
- 51201 CALL TO LLANDUDNO HEADSTOCKS NOT WORKING R.H
GLOW PLUG CHANGED & TESTED UNABLE TO REPAIR L.H SIDE.
- 40022. WINDSCREEN WIPER NO.1 AND DRIVERS SIDE REPAIRED.
- 50546. NO.2. ENGINE FAN & SHAFT. BROKEN. & DAMAGED.
ALSO FAN MOTOR. LOOSE ON HOLDING BRACKET.
- 50593. NO.2 ENGINE CARDAN. SHAFT BROKEN ON F/DR.
3 CAR SET ON NO.5. STOPPED. ENGINES &
F/DR TO EXAM & ISOLATED. ETC:-

Nov 3 - 2 - 82

CAFOLMES D. Images P. Cox.

P/CAR	Miles
50929	120790
51919	3020
50593	—
50546	—
52046	30660
50939	34360
51175	177460
50949	—

R.T 66308 Empty.
R.T 68204 Full

FUEL IN TANKS No1 6000 No2 1,500 TOTAL 7,500

Cars Fuel Ins Btc.

51175 - 50949 - 51919 - 50929 - 50939 - 59218
56333 56232 56151 56361 52046 50546

COVERING STEEL

BS1 SR SR SR CR SC SC BSC
34682 - 24840 - 24126 - 24843 - 15987 - 25309 - 24846 - 35756

Locos: - 40170 - 40003 - 40022 - 40069 - 25323 - 47515

Locos

40170 - TO CREW FOR REPAIRS TO (PAULI BLOWING CONTROL FUSE BOX)
40022 - A EXAM TO BE COMPLETED.
25323 - REPORTED PAULI NO CHARGING AND LOSS OF AMP ABOVE 400MPS
25069 - TO CREW FOR REPAIRS. SYSTEM DUD BRIT CAR'S

DMU - 50593 NO2 BNG CADDON START BROKE ON FINAL PAULI BLOW
50546 NO3 BNG PAN START AND MAIN BLOWER LOOSE.
51175 PAULI BRIT PUT ON CHARGE.

B.A. ROBERTS. M. PRICE.

40022 A-EXAMINATION CARRIED OUT.

50543. N^o2 ENG CARBON SHAFT REMOVED + MADE SAFE TO TRAVEL. ENG + F/DRIVE ISOLATED.

50546 N^o2 ENG PAN FAN SHAFT BROKEN. e COWLING MISSING. ENG + F/DRIVE ISOLATED MADE SAFE TO TRAVEL.

56232. FRAT BATTERS PUT ON CHARGE - BATT CELLS TOPPED UP.

D. HILL. M. PRICE. P. COX 20.00.

50949. N^o2 ENG EXHAUSTOR + ALTERNATOR BELTS MISSING NOW BELTS FITTED + ADJUSTED.

THUR 4 - 2 - 82

CAFOLLOS D. TRIGGS P. Cox.

P/CHG

MILES

FUEL IN TANKS NO1

NO2

TOTAL

SECURITY OF ALL LOCOS AND DMU'S ON DEP AND POST PRECAUTION.
I.E. LOCOS AND DMU'S RUN-UP FROM TIME TO TIME RUC. ALL AS WED.

CHANGES

P/CH	MILES
51175	
50949	—
51919	
50929	
50939	
52046	
50593	—
50546	—

Roll IN TANKS NO1 NO2 TOTAL

Car Roll Point Inc. Acc

50593

51175-50949-51919-50929-50939-52046
 56333 56232 56151 56361 52046 50546

COACHING STOLEN

352 52 51 52 22 52 52 852
 34682-24840-24126-24843-15987-25309-24846-35156

LOCOS ?

47515 OUT OF COURSE ATTENTION DRIVER REPORTED UNABLE TO START
 UP LOCO FOUND HEADON TANK LOW FILLED UP.

40069 OUT OF COURSE ATTENTION DRIVER REPORTED UNABLE TO START
 UP LOCO FOUND HEADON TANK LOW FILLED UP

47452 CAME OUT TO STATION DRIVER REPORTED FAULT LIGHT UP
 ON PANEL. LOAD REG STUCK IN FULL FIELD RESET. BY SWITCHING
 OF POWER ROLLYS RESET AND STATIC TEST FOR PUMPS OK

40022 CAME OUT TO YARD DRIVER REPORTED LEAK OF CENTRAL
 AIR PRESSURE CONTROL VALVE STUCK RESET.

SAT 6 - 2 - 82

P/CAR	MILES
50206	7330
51175	U/R
51184	100140
51186	10190
51430	—
51497	—
50929	120950
50939	34650
52046	34950

RUL IN TANKS NO1 6000 NO2 500 TOTAL 6500

CARS RUB OIL WATER ETC.

50206-51175-51184-51186-51430-50929-50939
56058 56333 56342 56357 51497 56361 52046

COATING STEEL

NDV SZ SZ SZ SZ SZ SZ NDV
80515-25375-24887-25582-15935-24109-25857-81032

LOCO'S RUL INS: 47187-47414-40003-40022-40069

40069 A. EXAM COMPLETED AT 203740 MILES BRAKE
BLOCKS OR RUB OIL RUL ETC.

40012 A EXAM TO COME IN TEN DAY STAP.

SAT 6 - 2 - 82

D. Hill M. Price.

CAR'S FUZZLED ETC:-

51189/56343.

51919/56151.

LOCO'S FUZZLED ETC:-

"A" EXAM CARRIED OUT ON 40012.

40069.

- 47409. CALL TO STATION. DR REPORTED WINDSCREEN WIPER ARM UNCOUPLED WIPER ARM REPLACED & ADJUSTED.
- 40012. WINDSCREEN WIPER DRIVERS SIDE W/1 AND NOT WORKING. WIPER MOTOR CHANGED. (NEW MOTOR FROM CROWD)
- 51189. W/1 WING THROTTLES UNCOUPLED, ARM REPLACED & TESTED.
- 51919. FLAT BATTERIES. PUT ON CHARGE TESTED ETC:-
- 56333. CALL TO GLANDUDNO. NO 6 TUBS BLOWN NOW TUBS FITTED & TESTED.

SUN 7 - 2 - 82

CAFouLDES P. COX.

Re - SECURITY OF ALL LOCOS AND DMUS ETC ON DEL I.E. LOCOS AND DMU ENGINES RUN-UP FROM TIME TO TIME AS FOR PROT. PRECAUTIONS ETC.	P/CAR	MILES
	50206	7410
	52046	35260
	50939	34960
	51189	42850
	51497	—
	51430	—
	51175	U/R
	51184	100340

FUEL IN TANKS NO 1

NO 2

TOTAL

CARS FUEL HAS EXAM

50206 - 52046 - 51189 - 51497 - 51175 - 51184
 56058 50939 56343 51430 56333 56342

Locos :- $\left\{ \begin{array}{l} \text{No 1} \\ \text{No 2} \end{array} \right.$ 47439 - 40012 - 40069 - 40003 - 40022
150 full 3 full 3 full 3 full 3 full

COACHING STOCK ETC

* BSL SL SL SL * CL SL SL BSL.
 34682 - 24840 - 24126 - 24843 - 15987 - 25309 - 24846 - 35176
 51175 FLAT BATT PUT ON CHARGE.
 51184 ALTERNATOR AND BATTERY BELTS MISSING FROM NO 2 ENG BELTS FITTED
 BSC 34682 FLAT BATT PUT ON CHARGE 2nd only also dynamo belt fitted
 CL 15987 FLAT BATT PUT ON CHARGE NOW dynamo belt fitted (LIGHTS OFF ON)

Monday 8th Feb 82.

	P/CAR NO	MILEAGE
R/T 66308 m/t		
R/T 68204 FULL		

FULL IN TANKS. No 1 5,100 No 2 500 TOTAL 5,600

B.A. ROBERTS D. HILL. M. PRICES.

CAR'S ROLLLED ETC:-

51175. 51184 51189 52046. 50206 51497.
56333 56342. 56343. 50939 56058. 51430.

LOCO'S ROLLLED ETC:-

40003. 40069 40022. 47439. 40012.

STOCK EXAM.

34682. 24840. 24126. 24843. 15987. 25309.
24846. 35176.

MON 8-2-82

CH FOULES P. COX.

CARS FUEL INS. 50399
56159

LOCOS' 40012 - 40003 - 40069

50399 - CALLED OUT TO STATION REPORTED T/CAN HEATERS NOT WORKING FOUND TO HAVE FUEL PAST TAKEN OUT OF SERVICE BROUGHT ON SIZED PUT ON CHARGE CURE TESTED FOUND FUEL FUSE BLOWN REPAIRED ALSO 2 BLOW PLUGS CHANGED 2 HEATERS MADE TO WORK.

51189 - CALLED OUT TO STATION DRIVER REPORTED NO POWER FROM CAB CONTROLLER FOUND LOSS OF AIR PRESSURE DUE TO PAVLEY R.P. VALVE STOCK TEMP REPAIRED AT LANTHORN AND STATION FURTHER ATTENTION TO PAVLEY WHEN BACK ON DUTY.

40022 CALLED OUT TO GRID DRIVER REPORTED BAD FUEL LEAK IN BLOWING ROOM LOCO PUT FURTHER ATTENTION WHEN ON SIZED AFTER SHUTTING.

Monday 8th

D Triggs P Cox

Fuel leak A side loco

40022 Fuel pipe Taken off
repaired and replaced loco run
up OK

25220 Fuelled oil water
and Exhausters Topped up

40003 Fuelled oil water and
Exhausters Topped up

Called to Landrover car 51189
losing air throttle & P Valve

Taken off cleaned & replaced

Seals Fuelled etc

50400 51189

TUESDAY 9TH FEB 82.

P/CAR NO	MILEAGE.
51184	100680.
50399.	276160.
50400	83440
51189.	942920.
50939	35250.
52046.	35560.
50807	—
50779.	—

R/T 68204 Full.

FUEL IN TANKS. No 1 3,900 No 2. 400. TOTAL. 4,300.

B. A. ROBERTS. D. HILL. M. PRICE.

CARS. FUELLED ETC:-

51184. 50399. 50400. 51189. 50939. 50807.
56342. 56159. 56150. 56343. 52046. 50779.

LOCO'S. FUELLED ETC:-

40012. 47491. 40003. 40022.

Stock Exam.

81032. 25857. 24109. 15935. 25582. 24887.
25375. 80515.

TUE 9-2-82

C.A. Foulkes P. Cox.

RE - SECURITY OF ALL LOCOS AND DMU'S ON DEP LOCS AND DMU'S RUN-UP AS PER PROS PRECAUTIONS BKT.

51189 - 50400 - 50779 - 52046 - 51184 - 50399
56343 56150 50807 50939 56342 56159

LOCO'S 40012 - 40022 - 40003 - 47491

56343 - LOW LIGHTS PUT ON BATT CHARGE CIRC TESTER ALSO
ATTENTION TO BUGGER CIRC TRACING FAULT REPAIRS AND
NEW BUGGER CONTROL UNIT FITTED

50779 REPAIRS TO SPEEDO GEAR DRIVE. BOSS REMOVING
AND REPAIRING SERVICING CIRC CHECKING FAULT ON TRAIN
LIGHTING CIRC NO FEED TO THROUGH CONTROL SWITCH WIRE DIS

56342 - FLAT BATT PUT ON CHARGE.

D. Hill. B. Roberts M. Price

25857. MK1 Flat BATT'S. CHARGED NO. 9 FUSE BLOWN.
NEW FUSE FITTED. ALSO DYNAMO FIELD FUSE
BLOWN. NO. 3 FUSE FITTED.

50400. OIL LEAK ON NO. 1 ENGINE. EXAM & FOUND OIL
PIPE TO COMPRESSOR. BROKEN. REMOVED NEW PIPE
FITTED & TESTED.

Loco's Fuzled etc:-

47491 40012.

40012. Two TONS Horn Valve stuck. NO. 1 and Drivers
Sids Valve removed cleaned replaced & tested.

47491. Coolant. Very Low. System topped up & tested.
FOR LEAK'S FOUND. Flex Hose to Pressure
Charger leaking bad. Hose removed & new
Hose fitted. System topped up. Loco run up.
& tested.

WED 10-2-82

CAFOLUBS P-cox.

Fuel Ins

51196
56336

Locos Fuel Ins out yard yard.
40022 - 40003 - 40184

50807 } Called out to WANDUDDO STATION DRIVER REPORTED.
50779 } HEATERS NOT WORKING ALL 4 MADE TO WORK.

40022: OUT OF COURSE ATTENTION HEADON TANK FILLED
40012: - Called out to YARD OF GOODS WORK. DRIVER REPORTED
NO 5 & 6 TRACTION MOTORS ISOLATED DUE TO LOSS OF POWER.
WHEN WORKING TRAIN UNDER LOAD, ALSO BAD LUB OIL LEAK.
TRACING HAVLI ON OIL LEAK AND REPAIRS TO JOINTS ALSO
OIL PIPE NUTS SCREWED UP; ALL TRACTION MOTORS DE ISOLATED
AND RETESTED FOR HAVLI OVER 3000 AMP. AND NO HAVLI LIGHT
UP AND WORKING OK ON STATIC TEST IN SHED UNABLE TO HAVLI.
Loco stopped for BRACE BLOCKS THRU 11-2-82 TOPS INFORMED.
50939 CALLED OUT TO WANDUDDO STATION ATTENTION TO HEATER
GLOW PLUG CHANGE HEATER MADE TO WORK
51184 CALLED OUT TO STATION REPORTED TRAIN LIGHTS NOT WORKING
FOUND NO 4 FUSE BLOWN FUSE REPAIRED

D Yriggs P Box

40003 Fuelled oil water and
exhausters Topped up

A Exam carried out loco
40003

25234 Fuelled oil water and
exhausters Topped up

51196 Fuelled oil water etc

~~BAROBORTS J Hill M. PILES~~
~~CAR'S FUELLED ETC~~

THURSDAY. 11TH FEB. 82

P/CAR NO	MILES
50400	83740
50398	40250
50399	276410
51196	2010
50939	35540
52046	35850
50807	—
50779	—

R/T. 68204 M/T.

FUEL IN TANKS N^o1 4,700. N^o2 6000 TOTAL. 10,700

BAROBURTS D. HILL M. PRICE.

CAR'S. FUELLED ETC:-

50400. 50398. 50399. 51196. 50939.
56150. 56164. 56159. 56336. 52046.
50807/ 50779.

COCOS. FUELLED ETC:-

40022. 47492. 40003. 40012.

STOCK LxMM.

35176. 24846. 25309. 15987. 24843. 24126.
24840. 34682.

THUR 11-2-82

CHARLES P. COX.

ALL HS ABOVE AND SECURITY OF VAN LOCOS AND DMUS
ON DEL LOCOS AND DMUS RUN-UP AS PER PRESS PRECAUTION

40012 BRANE BLOCK 24 BITED ALL ROUND AND BRANE
TEST CARRIED OUT TOP'S IMPROVED

FRIDAY 12TH FEB 82.

BAROBERTS D. HILL. M. PRICE.
CARS. FUELLED ETC. -
50400/56150.

LOCO'S FUELLED ETC. -
40022.

Fri 12-2-82

CAFOLVER P. COX.

CARS RUC ON WATER. BZ

51192 ATTENTION TO AIR HOPE ADJUSTED AND MADE TO WORK.
56354 ALSO ATTENTION TO ALL 4 HOATES MADE TO WORK.

50779 CALLED OUT TO STATION REPORTED BUZZER NOT WORKING IN CAB REPAIRED

LOCOS 25200 - 40012

D Yrigoy

Called to Llandudno car 51192
windscreen wiper arm uncoupled
replaced 40003 fuelled oil water and
Exhausters topped up 25324 fuelled
oil water and Exhausters topped up
25220 fuelled oil water and
Exhausters topped up

Called to Llandudno car 50399 no train Regs
These Blown changed

SAT. 13TH FEB 82

P/CAR NO	MILOMAS.
20399	276730.
51177	22120.
50398	40550.
51203.	281190.
50939.	35890.
52046.	36150.
51518.	—
51587	—
51192.	235740.

FUEL IN TANKS NO 1 3,100 NO 2 600 TOTAL 9,100.

BAROBERTS & HILL M. PRICE.

CAR'S FUELLED ETC:-

50399.	51177	50398.	51203.	50939.	51192.	51518.
56159.	56269.	56164	56351.	52046.	56354.	59580
						51587.

Loco's FUELLED ETC:-

40012. 47450. 47432. 40022. 25167.

Stock Exam.

81032. 25857. 24109. 15935. 25582. 24887
25375. 80515.

24109. DYNAMO BOLTS MISSING NOW BOLT 197700.
ALSO PLAT BATT'S PUT ON CHARGED ETC:-

51177. NO 1 AND EXHAUSTOR + ALTERNATOR BOLTS
MISSING NOW BOLTS 197700. + ADJUSTED.

51518. PLAT BATT'S PUT ON CHARGED ETC:-

47450. D.S.D. ISOLATED BY DRIVER WILL NOT RESET.
VALVE REMOVED. STRIPPED CLEANED. REPLACED & TESTED.

25167. EXHAUST MANIFOLD JOINTS BLOWING ON
PRESSURE CHARGER. NEW JOINTS FITTED & TESTED

D 41995 P 66X

A Exam carried out Loco 25167
40022 fuelled oil water and exhaust or
topped up. called to handover car 51587
No 1 Engine Exhaust pipe and silencer broken
Secured and set worked to chaser 51587
No 2 Gear Box faulty

Sunday. 14TH FEB. 82.

P/CAR NO	MILEAGE.
51192.	235990.
50206.	7730
50398.	40790.
50400.	84140.
51578.	—
51587.	—
51203.	281520

D. HILL. M. PRICE.

CAR'S. FUEL LND ETC:-

51192. 50206. 50398. 50400. 51203. 51578.
 56354. 56058. 56164. 56150. 56351. 59580.
 51587.

Loco's. Exam ETC:-

25283. 40022. 40012. 47455.

Stock Exam.

34682. 24840. 2426. 24843. 15987. 25309.
 24846. 35176.

51518. R.A. MARKER LIGHT NOT WORKING FOUND WIRE TO SWITCH BROKEN. WIRE REPLACED. + TESTED.
56058. PANEL LIGHT BULBS. MISSING 6 NEW BULBS FITTED. ALSO SCREWS. MISSING FROM THROTTLE CONTROLLER NEW HOLDING SCREWS FITTED + TESTED
56150. FLAT BATTERIES. PUT ON CHARGES ETC:-
51192. NO1 ENGINES + F/DR ISOLATED. FROST WATER DEFECTIVE. CAR TO CHESTER FOR REPAIRS.
51518. NO1 LOADING EXHAUST PIPE TO MANIFOLD. BOLTS. MISSING NEW NUTS + BOLTS. FITTED. + TESTED.
25283. SANDERS. MADE TO WORK.

HILL. M. PRICE.

CAR'S FUELLED ETC:-

50409/56152.

LOCO'S FUELLED ETC:-

25042. 25283

25167. BRAKE BLOCKS. CHANGED. ALSO. L.H. FRONT SLACK ADJUSTOR. SEIZED. REMOVED STRIPPED. REPAIRD. REPLACED. NEW END.
50409. WINDSCREEN WIPER ARM UNCOUPLED. REPLACED. & ADJUSTED.
56152. FLAT BATT'S. PUT ON CHARGES ALSO L.H. GLOW PLUG CHANGED. BOTH MOTORS. TESTED.
- 47561 CALL TO STATION. SPEEDOMETER NOT WORKING. MOTOR ON AXLE DAMAGED. UNABLE TO REPAIR LOCO TO CROWS. *
47530. CALL TO STATION. DR REPORTED EARTH FAULT LIGHT BRIGHT. FLAG RESET & TESTED.
- 51194 CALL TO STATION. DR REPORTED FLEX AIR PIPE BETWEEN P/CAR & T/CAR HOLES. NEW PIPE FITTED REPAIRS CARRIED OUT @ LHANDLING TO SAVE DELAY.
25042. L.H. SETTLE TANK GAUGE LEAKING. NEW GAUGE FITTED. COOLANT TOPPED UP & TESTED.

TUESDAY FEB 16TH 82

	PICAR	MILEAGE
	50409	115310
	50400	84350
	51947	53600
	52062	52240
	51203	281820
	50398	40940
	50208	157060
R.T. 68204 M.T 64257 Full.		

FUEL IN TANKS NO1 1000 NO2 6000 TOTAL. 7000

B.A. ROBERTS. D. TRIGGS. P. COX.

CARS FUELLED ETC:

50409 50400 51947 51203 50398
56152 56150 52062 56357 56164

50208
56060.

LOCOS FUELLED ETC: 40022 47432 25167 25283

STOCK EXAMINED. 80515 25375. 24887 25582
15935. 24109 25857 81032

25582 PLAT BATT'S PUT ON CHARGED CIRCUIT CHECKED ETC.
ALSO NEW DYNAMO BOLT FITTED.

51947. NO2 WVE EXHAUSTOR & ALTERNATOR BELTS
MISSING NEW BELTS FITTED & ADJUSTED.

56150 PLAT BATT'S PUT ON CHARGED NO3 DYNAMO FUSE
BLOWN NEW FUSE FITTED

25167 SANDWES MADE TO WORK.

D. Hill M. PRICES

- 47432 "A" EXAM CARRIED OUT ALSO R.H. TR. BEARD SLACK ADJUSTOR. SEIZED. NO.1 END. REMOVED REPAIRED REPLACED + ADJUSTED.
- 50398. TRAIN LIGHTS NOT WORKING FROM VAN OR CAB NO.4 FUSE BLOWN NEW FUSE FITTED + TESTED. ALSO. PANEL LIGHTS NOT WORKING SWITCH DEFECTIVE N.1.S.
- 56060. FLAT BATT'S PUT ON CHARGE CIRCT CHECKED. LIGHTS + HEATERS TESTED..

B.A. ROBERTS M. PRICES P. COX 2000.

40022. "A" EXAM CARRIED OUT.

D. HILL. M. PRICE

CARS FUELED ETC:-

51919/56151. 51199/56353.

LOCOS FUELED ETC:-

40090. 25167.

47201. CALL TO STATION. WIPOX AIR PIPE BROKEN. NO. 1 LIND
BY MOTOR REPAIRED & TESTED.
- 56351 CALL TO STATION. L.H. HEATER MADE TO WORK.
56151. PLAT BATTERIES. PUT ON CHARGE & TESTED. L.H.
HEATER GLOW PLUG CHANGED.
56150. CALL TO STATION. HEATERS NOT WORKING L.H. GLOW
PLUG CHANGED. UNABLE TO REPAIR R.H. HEATER. SET
TO WORK TO CHESTER FOR REPAIRS.
- 47487 CALL TO STATION PARTIAL FAULT LIGHT. BRIGHT. FLAG
RESET & TESTED.
51199. NO. 2 ENGINES MANIFOLD JOINTS BLOWING. NEW JOINTS FITTED.
52062. CALL TO STATION. HEATER NOT WORKING UNABLE
TO REPAIR. @ STATION DRAGON AIR TYPE HEATER.
47442. CALL TO STATION. E. T. H. NOT WORKING. UNABLE
TO FAULT. LOCO WORKED TO CROWD FOR REPAIRS
CROWD MAINT INFORMED.

B. A. ROBERTS. M. PRICE. P. COX.

CARS FUELED ETC: 50400 51947 50398
56150 52062 56164.

LOCOS FUELED ETC: 25283 47484 47409.

56363. CALLED TO MANDUANO HEATER NOT WORKING. FUEL
SYSTEM BLED. HEATER TESTED. OK.

25283 R. H. SETTLING TANK GAUGE GNASS BROKEN
RENEWED

56347 AMH DYNAMO BELTS SLIPPING. NEW BELTS FITTED
FROM DRUM.

52062 NO. 1 ENG FAN BELTS MISSING NEW BELTS FITTED.

THUR 18- 2 - 82

CHAFOULKS D. TRIGGS P. Cox.

P/Car	MILES
51184	101720
51919	4390
50398	41230
50208	151060
51201	80746
50400	84480
51947	53830
52062	52470

RUC IN TANKS No 1 1,000 No 2 4,300 TOTAL 5,300

CARS RUC ON WATER LUG

51184 - 51919 - 50398 - 50208 - 51201 - 50400 - 51947
56342 56151 56164 56060 56347 56150 52062

Locos RUC LUG 47409 - 25167 - 25283

25283 WANTS "A" EXAM ALSO NOT RUCED

COACHING STOCK

BOL SL SL CL SC SL SL SL
35176 - 24846 - 25309 - 15987 - 24843 - 24126 - 24840 - 34680

D. HILL. M. PRICE.

25283. "A" EXAM CARRIED OUT. ALSO TOP
EXHAUST PIPE JOINT ON PRESSURE CHARGER.
BLOWING NEW JOINT FITTED & TESTED.

51201. NO. 2 ENGINES EXHAUSTOR + ALTERNATOR
BOLTS MISSING. NEW BOLTS FITTED & ADJUSTED.

B. A. ROBERTS. M. PRICE. P. COX.

CANS FUELLED ETC.

WOCOS. FUELLED.

56164 FLAT BATTERS PUT ON CHARGE. ETC.

56164 BOTH HEATERS REPAIRED.

50208. R.H. HEATER REPAIRED.

Feb 19-2-82

	P/CHG	MILES
	51184	
	52062	
	51947	
	50400	
	51201	
	51919	
	50398	
	50208	

FUEL IN TANKS NO1 1000 NO2 4,300 TOTAL 5,300

CHAS FUEL OIL WATER. ETC.

51184-52062-50400-51201-51919-50398-50208
56342 51947 56150 56347 56151 56164 56060

Locos 147409-25283-25167

COACHING STOCK

35176-24846-25309-15987-24843-24126-24840-84682

D. HILL. M. PRICE.

CARS FUELLED ETC:-

50628 / 56503.

LOCOS FUELLED ETC:-

40167. 25283.

40167. DROP LIGHT WINDOW. 2ND MAN'S SIDE WILL NOT OPEN. X SPRING FOUND BROKEN. NEW SPRING FITTED.

52062 CALL TO STATION. HEATER NOT WORKING UNABLE TO REPAIR DRAGON AIR TYPE HEATER.

50628. NO. 1 LAMP FAN BOLTS MISSING ALSO FAN MOTOR HOLDING STUDS BROKEN. (2) NEW STUDS FITTED NEW BOLTS FITTED + ADJUSTED. ENGINE RUN UP & TESTED.

51203 CALL TO STATION. HEATERS NOT WORKING NO. 6 FANS BLOWN. NEW FANS FITTED + TESTED.

B.A. ROBERTS. M. PRICE. P. COX.

CARS FUELLED ETC: 51947 51919
52062. 56151.

LOCOS FUELLED ETC: 25167.

56351 CALLED TO MAINTENANCE BUZZER NOT WORKING IN CAB. ADJUSTED + SECURED. (SCREWS MISSING)

52062 DRAGON AIR HEATER REPAIRED. BURNER HEAD REMOVED & CLEANED.

SAT 20-2-82

CAFOLKES D. TRIGGS P.O.A.

P/CAR	MILES
50927	72110
51174	151450
51947	54000
52062	52630
51919	4410
51584	5110
51575	5030
51188	76080
50628	64460
50398	41380
64609	MT
64257	FULL

FUEL IN TANKS NO1 NO2 TOTAL

CARS FUEL ON WATER

50927-51174-51947-51919-51188-50628-50398 51584
 56214 56350 52062 56151 56348 56503 56164 51575

Locos 47432-25126-25283-25167-40157

CONCRETE STEEL

NDV SK SL SL CL SL SL NDV
 80515-25375-24887-25582-15935-24109-25857-81032

51584; ATTENTION TO HITCHES 2 WAGS TO WORK.

59581; " " " " " "
 51575; " " " " " "

B. A. ROBERTS, M. PRICE.

CARS FUELLED ETC. 50349 57188 57584
56159. 56348. 57581
57575.

HOCOS FUELLED ETC. 40064 25283.

57584 CALLED TO STATION HEATERS NOT WORKING.
UNIT TAKEN OUT OF SERVICE.

47555. W/NIER N° 1 END. UNCOUPLED REFITTED +
ADJUSTED.

25283. SANDERS NOT WORKING. MADE WORKABLE.

50399 N° 1 END. EXHAUSTER BELLS MISSING NEW
BELLS FITTED.

56348 D.S.D THROTTLE CONTROL STUCK. STRIPPED
& CLEANED. REPLACED & TESTED.

J Triggs P Box

25167 Fuelled oil water and Exhauster
topped up 40012 Fuelled oil water
and Exhausters topped up 25126 Fuelled
oil water and Exhausters topped up 25283
Fuelled oil water and Exhausters topped up
called to Houndro car 51177 Heater
made to work called to Houndro car
51201 Heater not working Flat Battery
brought in shed put on charge

SUNDAY FEB 21ST 82

	PLCAR	MILEAGES
	50398	41610
	50399	277540
	51188	76200
	50926	118330
	50398	41610
	51188	76200
	50399	277540
	51484	52900
	51575	5210

D Yriggs P Cox

47414 Fuelled oil water
and Exhausters Topped up

25167 Fuelled oil water
and Exhausters Topped up

25234 Fuelled oil water and
Exhausters Topped up

25283 Fuelled oil water
and Exhausters Topped up

all alternator and Exhauster

Belts off Pulley's no: Engines
replaced and adjusted

MONDAY FEB 22ND 82

PLCAR	MILEAGES
50926	18330
57567	—
57584	5290
57575	5210
50628	64670
57201	81280
50409	115850

R.T. 64609 M.T.
u 64257 Full.

FUEL IN TANKS N^o1 5.100 N^o2 4.800 TOTAL 9.900

B. A. ROBERTS. D. F. HILL. M. PRICE.

CARS FURNISHED ETC: 50926 50409 57201 56628
57584 57567 56152 56347 56503
59581
57575.

LOCOS FURNISHED ETC: 25283. 25167 47442. 40064
47532.

Stock EXAM. 34682 24840 24126 24843 15987
25309 24846 35176.

24126. FLAT BATT'S PUT ON CHARGES ALSO NEW DYNAMO
BELT FITTED.

57575. N^o1 LOW FLUX EXHAUST PIPE BROKEN NOW PIPE
FITTED & TESTED.


57584 FLAT BATT'S PUT ON CHARGES R.H. HEATER BLOW
PLUG CHANGED L.H. HEATER SMOKING BAD NEW
HEATER WANTED. F.H.D.

59581. FLAT BATT'S PUT ON CHARGES N^o3 DYNAMO FUEL
CHANGED & R.H. HEATER FUEL PIPE BROKEN. REPAIRED.

50628. HEATER MADE TO WORK.

56152. TRAIN LIGHTS LOW PUT ON CHARGES & TESTED.

MON 22-2-82

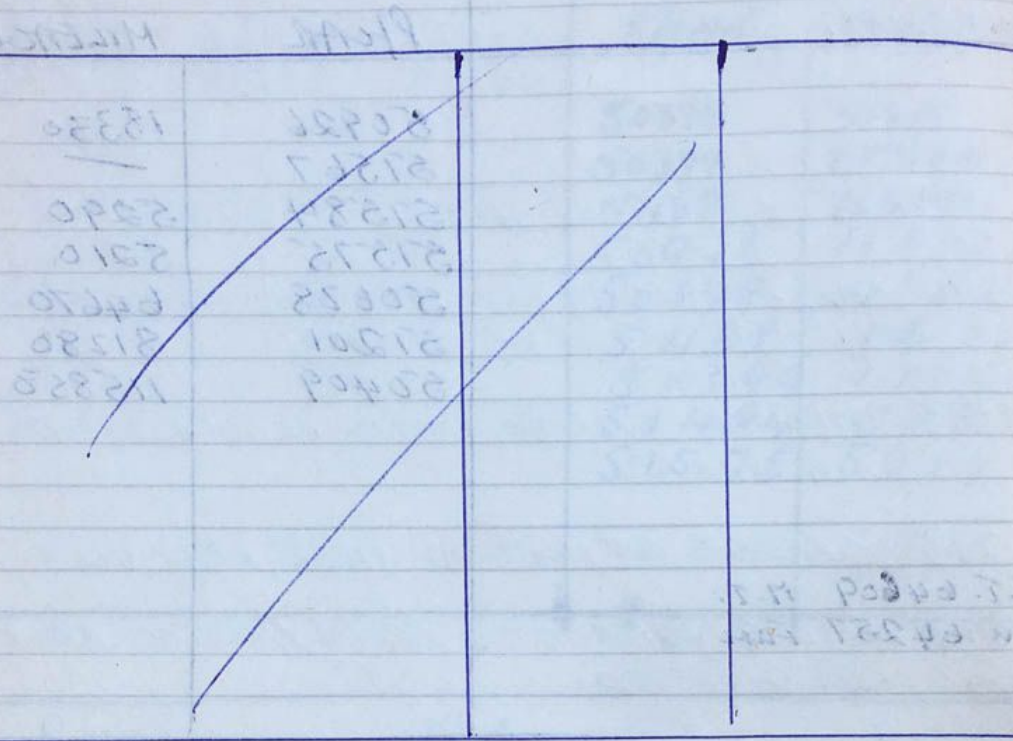

① Tripps P Cox

Locos Fuelled etc 25167 40012

25126 25283

Called to Llandudno Car 51177

Heater not working

Called to Llandudno Car 51201 Flat

MON 22-2-82

Battery

CAFoums

CARS PUT ON WATER BZ

51196 - 51201 - 51203 - 50926

56336 56347 56351 51567

Locos 25126 - 25283 - 47484

40064 CAME OUT TO YARD REPORTED UNABLE TO SHUT CAR WINDOW WINDOW REPAIRS

50927 CAME OUT TO LLANDUDNO STATION UNABLE TO REPAIR FAULT IN TIME AT STATION MUSTY MICRO CONTACT SWITCHES NEED FURTHER ATTENTION WHEN ON STOOD

56152 CAME OUT TO STATION REPORTED HEATERS NOT WORKING I MADE TO WORK

SR24887 FLAT BATT PUT ON CHARGES

Tuesday 23rd FEB 82.

	P/CAR NO	MILEAGE
	50471	—
	50523.	—
	50409.	116000
	50206	8310.
	51201	81370.
	51567.	4/R.
	50926	118620.
	51203.	282340.
	51196.	3480.
R/T 64609. m/t		
" 64257 Full.		

FUEL TANKS NO1 5,100. NO2 3,500. TOTAL 8,600

BA ROBERTS D. HILL. M. PRICE.

CAR'S PULLED ETC:-

50471 50409. 50206. 51201. 51567.
 59179. 56152. 56058. 56347. 50926.
 50523
 51203/56351. 51196/56336.

LOCO'S PULLED ETC:-

25283 25126. 47484. 40064.

Stock Exam.

80515 25375 24887. 25582. 15935. 24109.
 25857. 81032.

51203. WINDSCREEN WIPER ARM UNCOUPLED. REPLACED ADJUSTED. TESTED.
 25126. SANDERS MADE TO WORK.

59179. HEATERS NOT WORKING L.H. GLOW PLUG CHANGED.
 R.H. CONTROL PANEL REMOVED. FOUND TWO WIRES
 UNCOUPLED. ALSO LIGHT BULBS. BLOWN. WIRES
 REPLACED NEW BULBS FITTED. ALSO NEW GLOW
 PLUG FITTED. HEATERS TESTED.

51196 NO2 LMG. EXHAUSTOR & ALTERNATOR BOLTS OFF
 PULLEY ALL BOLTS REPLACED & ADJUSTED.

50471. NO1 LMG FAN BOLTS MISSING. ALSO FAN MOTOR.
 HOLDING DOWN STUDS. BROKEN. (2) MOTOR REMOVED.
 STUDS DRILLED. OUT. NOW STUDS. MADE FITTED MOTOR
 REPLACED. NEW FAN BOLTS FITTED. & ADJUSTED.
 LMG RUN UP & TESTED.

56058 FLAT BATT'S PUT ON CHARGE ETC:-
 50206 L.H. HEATER MADE TO WORK.

TUE 23-2-82

D Triggs Ploox

Loco 40064 Fuelled oil
water and Exhausters Topped up
47555 Fuelled oil water and
Exhausters topped up
25283 Fuelled oil water
and Exhausters Topped up 25167
Fuelled oil water and Exhausters
topped up
called to Handlucro car 51188
driver reported no train lights 7ade
Blown, changed OK

TUE 23-2-82

Chroules

Check fuel on WATER BCL.

51201 - 51919 - 51179 - 50754

56347 56151 56358 50814

Locos 25126 - 25283 - 47442

40064 - Checked out to YMS driver wanted HEADBOX TANK
Checked loco brought on shed out of course HEADBOX Filled

D Triggs P Box

40084 Fuelled oil water
and Exhausters topped up

40009 Fuelled oil water and
Exhausters topped up

25216 Fuelled oil water and
Exhausters topped up

called to Llandudno car 51779
no 1 engine cutting out air locked
Bled run up called to station loco
47441 sent topped up

WED 24-2-82

CAPOULKES

CARS RUC ON WATER WAZ

51201 - 50398 - 51200

56347 56164 56359

Locos 40084 - 25283 - 25154

40064 out of course for HENDER TANK FILLING UP.

51201 UNABLE TO START ENGINES DUE TO FLAT BATT
PRI ON CHARGE.

51200 CALLED OUT TO LLANDUDNO STATION TO SAVE
FURTHER DELAY REPORTED NO TRAM MOTORS IN P/CAR
TRAVELING BUILT ROUND FAULTY SWITCH IN CARS JAMBOD IN CH
50398 REPORTED BND LOSS OF CONTROL AIR PRESSURE - TRAVELING
FAULT TO FAULTY R/V VALVE VALVE REMOVED AND SERVICED

THURSDAY. 25TH FEB 82

	P/CAR NO	MILEAGE
	51919.	4730.
	51200.	12300.
	50398.	42000.
	50926.	119200.
	51567.	4/R.
	51587.	—
	51578.	—
	51201.	81370.
	50929.	123980.
R/T. 64609 m/t.		
" 64257 Full.		

FUEL INTANKS. NO 1 3,900. NO 2 2,100. TOTAL. 6,000

B. A. ROBERTS D. HILL. M. PRICES.

CARS FUELLED ETC:-

51919. 51200. 50398. 50926 51201

56151. 56359. 56164. 51567. 56347.

51587/59581. / 51578. 50929/56361.

Loco's FUELLED ETC:-

40084. 25283 25152. 47480.

40064 "A" EXAM CARRIED OUT.

25152. STANDARDS MADE TO WORK.

Stock EXAM.

80515. 25375 24887. 25582. 15935. 24109.

25857. 81032.

24109. FLAT BATT'S PUT ON CHARGES DYNAMO BOLT.
MISSING NOW BOLT FITTED

50939. LAMP HOLDER FOR NO 2 ENGINES DEFECTIVE
PANEL REMOVED. FOR WIRE BROKEN. REPAIRED.

56361. FLAT BATT'S. PUT ON CHARGES ETC:-

D Yards P Box

25133 Fuelled oil water
and Exhausters Topped up

40012 Fuelled oil water
and Exhausters Topped up

25283 Fuelled oil water and
Exhausters Topped up

THUR 25-2-82

CAFOLKES

CARS FUEL OIL WATER. ETC.

51192 - 50398 - 50512

56354 56164 59168

50460

Sealed fitted

Locos 25152 - 47107

50398 - CAME OUT TO LAMBUONO STATION 22000 REPORTED
HEADLAMP NOT WORKING ALSO TRAIN LIGHTS WERE NOT STOP ON TRACK
PAUL FOUND TO HAVE RAIL BAIT UNIT TAKEN OUT OF SERVICE AND
BROUGHT ON SHED AND PUT ON CHARGE

50512 - RAIL BAIT PUT ON CHARGE

59168 - RAIL BAIT PUT ON CHARGE

56358 - RAIL BAIT ON CHARGE.

FRIDAY 26TH MAR. 82.

	P/CAR NO	MILWAUKEE
	51200.	12590.
	50409.	116460.
	51192.	237350.
	50460.	—
	50512.	—
	51179.	26800.
	50926.	119490.
	51567.	4/R.
	50398.	42100.
R/T. 64257. } Full.		
" 64448 } Full.		
" 64609. M/T.		

PULLIN TANKS NO 1 2,500 NO 2 2,100 - TOTAL 4,600.

BAROBORTS J. HILL M PRICES.

CAR'S REWELDED ETC. -

51200. 50409. 51192. 51179. 50926.
 56359. 56152. 56354. 56358. 51567.
 50398/56164. 50460/59168/50512.

LOCO'S. FUELLED ETC. -

25152. 25283. 47107. 40093.
 25133. "A" EXAM CARRIED OUT. ALSO SANDERS
 MADE TO WORK & BOXES TOPPED UP.

STOCK EXAM.

35176. 24846. 25309. 15987. 24843.
 24126. 24840. 34682.

40093. EXHAUST PIPE JOINTS BLOWING NO 2 & 3 CYLINDERS.
 "A" BANK. NOW JOINTS FITTED.

50512. ALL ENGINE IRON BOLTS MISSING ALSO 2 BROKEN.
 STUDS. REMOVED FROM BOB PLATE NOW STUDS
 FITTED ALSO NEW BOLTS FITTED & ADJUSTED.

50460. AIR PIPE TO W/WIPER CONTROL VALVE BROKEN.
 PIPE REPAIRED + TESTED

D Yrigas P-Box

40093 Fuelled oil water and
Exhausters topped up 25133 Fuelled
oil water and Exhausters Topped
up 25126 Fuelled oil water
and Exhausters topped up 40012
Fuelled oil water and Exhausters
topped up called to Handford
Car 51201 Bad air leak Fose EP
Valve stuck Taken off cleaned & replaced

FRI 26-2-82

CA FOLLOWS

CRASH FUEL ON WATER LTR.

50940 - 50929 - 50398 - 52057
56273 56361 56164 51940

10205 40094 - 47480

40093 - Called out to yard to check on Hoadon Tank
Loco Blower on shed. Most of course attention to
Hoadon Tank Fines.

50929 :- Called out to station reported fuel leakage
from fuel tank left hand tank from gas line 2 way up the
No. 1 engine side unit taken out of service for home dep attention

50940 :- Reported marker lights not working taken to
for fault found switch in panel faulty also lamp holder
damaged none on hand to RT unable to replace F.H. AT

51940 :- Attention to marker lights faulty switches
temp made to work but new switches wanted